## **Technical Bulletin**

Model 911 C2/C4/T

Group 1

Subject:

Fan Bearing Drive/Belt Damage

Part Identifier 1905

Number 9301

**ATTENTION: Service Manager/Service Technician** 

**Models Affected:** 

1989-1992 911 Carrera 2/4

1991-1992 911 Turbo

Concern:

Noisy engine cooling fan bearing /damaged drive belts.

**General Information:** 

A damaged engine cooling fan bearing can cause the attached parts to run at higher than normal temperatures. Whenever the cooling fan bearing is found to be faulty, the following parts should also be replaced along with any visibly damaged parts.


**Parts Information:** 

911 Carrera 2/4

orr ouricia 2/4		Intro into
Description	Part Number	Production
Spacer sleeve	964 106 515 01 (formerly 00)	8/24/92
Sleeve	964 106 211 01 (formerly 00) Manual	8/11/92
Sleeve	964 106 211 31 (formerly 30) Tiptronic	8/24/92
Washers	964 106 268 31 (formerly 30) Tiptronic	

911 Turbo

Description	Part Number	Production
Pulley	930 106 124 02 (formerly 01)	8/26/92
Spacer sleeve	964 106 515 01 (formerly 00)	8 /24 /92

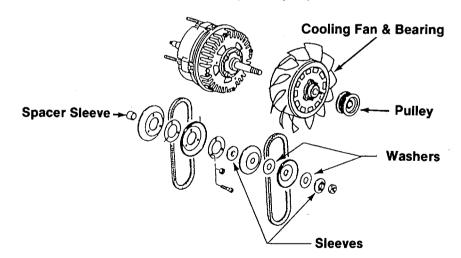





I-4--- :--4--