Technical Bulletin

Model 6 Cyl.

Group 8

Subject:

Rear Heater Blower Resistor

Part Identifier 8059

Number 9402

ATTENTION: Service Manager / Service Technician

Models Affected:

911 Carrera 2/4 1989-on

Concern:

Rear heater blower motor does not function.

General Information:

Newer version rear heater blower resistors have been installed as part of the P02 campaign and in production from the following motor numbers:

M6401 - 62P04996 Manual transmission M6402 - 62P51654 Tiptronic transmission

The new version resistor is different from the previous version in that the new version resistor has a manually resettable bi-metal thermoswitch which stops current flow to the first stage of the blower motor if a fault occurs in the blower motor circuit.

If this blower resistor bi-metal thermoswitch is tripped, it must be manually reset by pressing down the spring plate which is under the copper colored reed contact (see Figure A below). The reason for the thermoswitch activation must then be diagnosed and repaired.

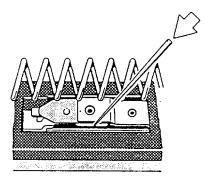


Figure A

Parts Information:

Part Number

Description

964 616 550 02

(formerly 964 616 550 00/01)

Heater blower resistor

©1994 Porsche Cars
North America, Inc.
All rights reserved. Cannot be
reproduced without written permission.
Service & Parts Publications.

