Technical Bulletin911 C2/C4
911 Turbo2Subject:Muffler MountingPart Identifier
2633Number
9304

ATTENTION: Service Manager/Service Technician

This bulletin supersedes Technical Bulletin Group 2, Number 9202, Book I, page 43.

Models Affected:

911 C2/C4, 1989-on 911 Turbo, 1991-on

Concern:

Loose or broken final muffler carrier plate or bolt.

General Information:

A modified spacer sleeve with a larger contact area on **the lower** bolt of the final muffler carrier plate and the two (2) mounting bolts (M8x75) that connect the carrier plate to the muffler have been changed.

Model

Group

The new version spacer sleeves have been used from production date April 15, 1991, from engine numbers:

62M 01670 Manual transmission 62M 54558 Tiptronic transmission 61M 02156 911 Turbo

The new mounting bolts have been used from production date January 14, 1993, from engine numbers:

62P 03255 Manual transmission 62P 51399 Tiptronic transmission

The new mounting bolts are of higher tensile strength and are torqued to a higher value than the former bolts.

Repair Information:

When repairing vehicles for loose or broken muffler mountings, the new version bolts, lower spacer and new torque specification should be used.

Parts Information:

(See Figure 1 for location of part)

Description


A upper spacer
** B lower spacer

* C M8x75–10.9 bolt (new) M8x75–8.8 bolt (former) Part Number

964 111 213 01 964 111 213 02 900 074 311 08

Note: *Torque mounting bolt to 35Nm (28Nm formerly)

**On vehicles without power steering, the lower spacer is also used on the top mounting point.

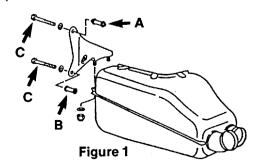

©1993 Porsche Cars North America, Inc. All rights reserved. Cannot be reproduced without written permission. Service & Parts Publications



SERVICE Page 1 of 1
April 27, 1993