Technical Bulletin All All All Subject: Repairing Horn Buttons On Air Bag Steering Wheels All Part Identifier 4810 Number 9105

ATTENTION: Service Manager/Service Technician

Models Affected:

All cars with air bags

Concern:

Repair procedures for horn buttons on cars with air bag steering

wheels.

Repair Information:

Hom buttons are serviceable. Replacement hom buttons, leaf springs

and contact plates are available from the parts department.

Disassembly, Assembly and Checking Procedure

Disassembly

1. Remove steering wheel

Refer to Workshop Manual 944 page 68-9

911 page 68-3 928 page 68-5

- 2. Pry out hom button with small screwdriver (Figure 1).
- 3. Remove leaf spring.

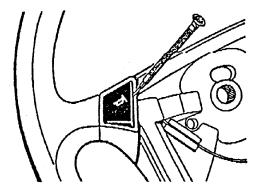


Figure 1

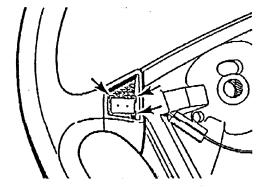


Figure 2

Assembly

- Insert leaf spring in the guides (arrows in Figure 2).
 Note: Silver contact in the middle of the leaf spring must face down.
- Install hom button. Engage upper locking tab first, then push in hom button entirely. Make sure all locking tabs are engaged. Button must move easily in and out without binding.



Technical Bulletin All All Subject: Repairing Horn Buttons On Air Bag Steering Wheels All Part Identifier 9105

Repair Information (cont.):

Checking Horn Button Operation

6. Connect ohmmeter to hom wire terminal and steering wheel housing (Figure 3).

Reading: infinite ohms

Push horn button Reading: 0-5 ohms

Check each button separately.

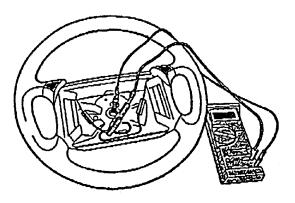


Figure 3

Parts Information:

7. Reinstall steering wheel.

Hom Button left side: Part Number 944 347 835 00 ___ Hom Button right side: Part Number 944 347 836 00 ___

Hom Button Housing left side: Part Number 944 347 831 00 ___ Hom Button Housing right side: Part Number 944 347 832 00 ___

Note: ___refers to color code. Refer to parts catalog for required color code.

Leaf Spring: Part Number 944 347 884 00 Contact Plate: Part Number 944 612 355 00



| Technical Bulletin | | All | Group 4 |
|--------------------|---|-------------------------|----------------|
| Subject: | Repairing Horn Buttons On Air Bag Steering Wheels | Part Identifier 4810 | Number 9105 |

Warranty Information:

R & R Steering Wheel

Damage Code: 4810100002 Labor Operation: 48101903 Time Units: 30

With steering wheel removed R & R 1 Horn Contact

Labor operation: 48104950 Time Units: 20

With Steering Wheel removed R & R 2 Horn Contacts

Labor Operation: 48105050 Time Units: 30

©1991 Porsche Cars North Arnerica, Inc. All rights reserved. Cannot be reproduced without written permission. Porsche Technical Publications

