## Technical Bulletin 911C2/C4 8 Subject: Heater Fan Motor, Securing 8530 9001

ATTENTION: Service Manager/Service Technician

Models Affected:

911 Carrera 2 and 911 Carrera 4 Model Year 1990 (L)

Concern:

Additional securing of heater fan motors.

**Repair Information:** 

The heater fan motors are secured with two plastic screws each, in addition to the locking tabs, from production date October 1989. When removing the fan motors, the screws must be removed before disengaging the locking tabs. The screws can be accessed through openings in the blower wheel (arrows in Figure 1). Reinstall both screws after repairs. Refer to 911 Carrera 2/4 Workshop Manual Volume VI, page 87–13 thru 87–15 for heater fan motor removal and installation procedures.

Fan motors with the additional securing screws can be identified by a white paint dot in the area of the manufacturers identification plate (arrow in Figure 2).


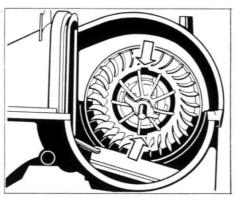


Figure 1

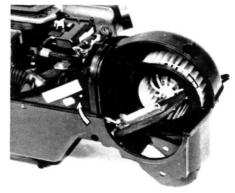

Model

Group

Figure 2

Dealership Distribution Routing Service manager .

Asst. manager

Shop foreman

Service technicia

Warranty admin.

Service technician

©1990 Porsche Cars North America, Inc. All Rights Reserved Technical Support Department

SERVICE

Page 1 of 1 May 29, 1990