Technical Bulletin 911 C2/C4 1 Subject: Underside Protective Plates and Heat Shield Mounting Part Identifier 1080 Part Identifier 9018

ATTENTION: Service Manager/Service Technician

Models Affected: 911 Carrera 2 and 911 Carrera 4


Concern: Underside protective plates and/or exhaust system heat shield

mounting bolts frozen.

Service Information: The mounting bolts can seize and make removal difficult when

removing protective plates and heat shields. Once the mounting bolts are removed, a coat of Optimoly HT, Part Number 000 043 004 00 should be applied to the bolt or nut

threads to avoid seizing and ease future removal.

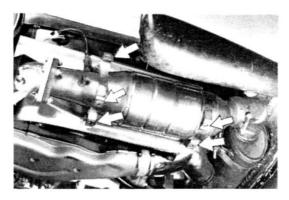

Caution: Part numbers given in this bulletin are for reference only.

Always check with your Parts Department for the latest parts

information.

Dealership Distribution Routing Service manager

Shop foreman

Service technician

Asst. manager _____

Warranty admin. _____

OCIVICO (COMMON

ERVICE

Service technician

1990 Porsche Cars North America, Inc. All rights reserved. Cannot be reproduced without written permission Porsche Technical Publications



Page 1 of 1 October 30, 1990