
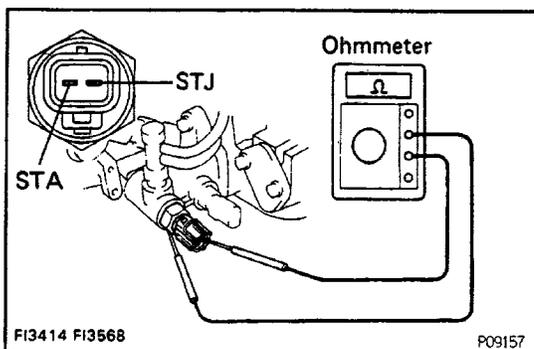


COLD START INJECTOR TIME SWITCH

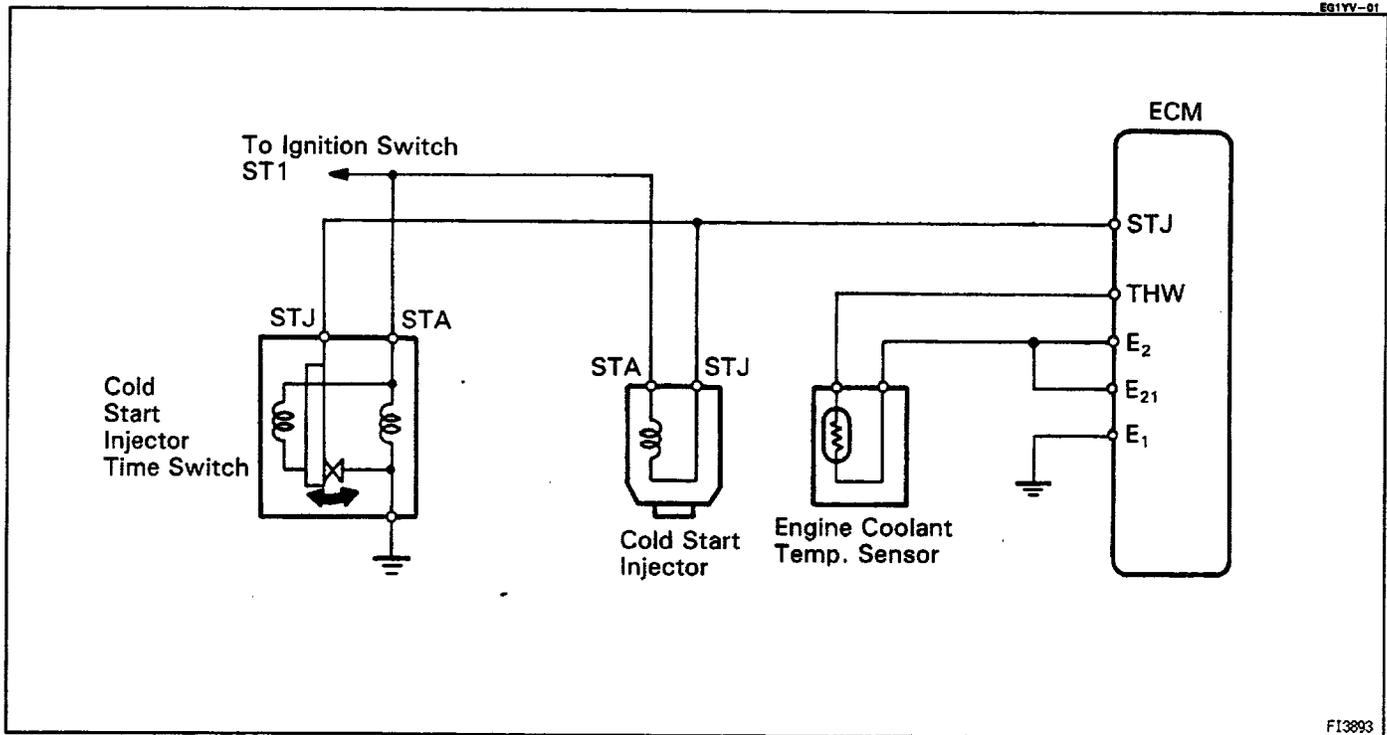

START INJECTOR TIME SWITCH INSPECTION

MEASURE RESISTANCE OF START INJECTOR TIME SWITCH

- (a) Disconnect the connector.
- (b) Using an ohmmeter, measure the resistance between terminals.

Between terminals	Resistance (Ω)	Coolant temperature
STA - STJ	30-50	below 10°C (54°F)
	65-90	above 30°C (86°F)
STA - Ground	30-90	-